Part 573 Safety Recall Report

Manufacturer Name: Ford Motor Company Submission Date : MAY 08, 2020 NHTSA Recall No.: 20V-263 Manufacturer Recall No.: 20S21

Manufacturer Information :

Manufacturer Name: Ford Motor Company Address: 330 Town Center Drive Suite 500 Dearborn MI 48126-2738 Company phone : 1-866-436-7332

Population :

Number of potentially involved : 10,460 Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1:					
	2019-2020 For	rd Mustang			
Vehicle Type :	LIGHT VEHICL	ES			
Body Style :	ALL				
Power Train :	GAS				
Descriptive Information :	The transmission not in park warning message and associated chime are only active for three seconds when the transmission is not in park and the ignition state is off, with driver door closed. The Ford internal requirement is for the chime to be active for ten seconds and the messge for thirty minutes.				
	this action to s line (1-866-43 specific inform Information Sy	pecific vehicles 6-7332) or by co nation regarding ystem (OASIS) da	can best be obtained ontacting a local For the vehicles from th	ormation as to the applicability of I by either calling Ford's toll-free d or Lincoln dealer who can obtain he Ford On-line Automotive Service	
Production Dates :				_	
VIN Range 1:	Begin :	NR	End: NR	☐ Not sequential	



20V-263

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

20V-263

Vehicle 2 : Vehicle Type : Body Style :	2019-2019	Ford Expeditio	n		
Power Train :	NR				
Descriptive Information :	for three se with driver for ten seco These vehic this action t line (1-866 specific info	conds when the door closed. Th nds and the me les are not proo o specific vehic 436-7332) or h	e transmission is no ne Ford internal re ssge for thirty min duced in VIN order les can best be obt by contacting a loca ling the vehicles fro	ot in park and the ig quirement is for the utes. . Information as to ained by either calli I Ford or Lincoln de	nition state is off, e chime to be active the applicability of
Production Dates :	OCT 16, 201	8 - OCT 13, 201	9		
VIN Range 1:1	Begin :	NR	End: NR		Not sequential
VIN Kange 1:1	Begin :	NK	End: NR		Not sequenti

Description of the Defect.	active for 3 seconds when the transmission is not in Park and the ignition state is OFF with driver door closed. Instead, the chime should be active for 10 seconds and message should display for 30 minutes when the driver's door is closed.
FMVSS 1 :	NR
FMVSS 2 :	NR
	The Transmission Not in Park warning and associated chime is designed to alert the driver that their vehicle is not in the park position. A shorter than designed duration of the Transmission Not in Park warning and associated chime could result in a driver exiting their vehicle while not in park without being sufficiently alerted. This could result in unintended vehicle movement, increasing the risk of injury or crash.
Description of the Cause :	The supplier did not implement the feature as required by the Ford specification.
Identification of Any Warning	None
that can Occur :	

Involved Components :

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Component Name 1 :Instrument Panel ClusterComponent Description :Not in Park Warning MessageComponent Part Number :KR3Z-10849-A (Mustang) KL1Z-10849-A (Expedition)

Supplier Identification :

Component Manufacturer

Name :Denso International America, Inc.Address :24777 Denso Dr.
Southfield MICHIGAN 48033

Country: United States

Chronology :

October - December, 2019

Ford's Critical Concerns Review Group (CCRG) reviewed a concern where it was reported that the Transmission Not in Park warning message and associated chime were not performing to design intent on certain Mustang and Expedition vehicles. The CCRG reviewed the design requirements for this warning stategy, which was for the warning message to be displayed in the cluster for 30 minutes and for the chime to remain active for 10 seconds. The CCRG researched whether this strategy reflected a regulatory requirement and determined that it did not. The CCRG also investigated different configurations of the Mustang and Expedition and confirmed that this condition was present only on a certain instrument cluster with a mechanical column shifter.

December 2019 - April 2020

This concern was reviewed with Ford's Technical Review Group, who requested a broader review with other departments at Ford. The Technical Review Group also provided direction to the CCRG to continue its investigation. The CCRG continued to research the scope of the condition, including whether other vehicle lines or model years could be affected. In April 2020, Ford's Technical Review Group reconvened and recommended a field service action.

On May 1, 2020 Ford's Field Review Committee reviewed the concern and approved a field action.

Ford is not aware of any reports of accident or injury related to this condition.

The information contained in this report was submitted pursuant to 49 CFR §573

20V-263

Description of Remedy :

Description of Remedy Program :	Owners will be notified by mail and instructed to take their vehicle to a Ford or Lincoln dealer. Dealers will reprogram the instrument panel cluster using Integrated Diagnostic Software (IDS) level 116,04 or higher for the Mustang. Expedition will require use of Ford Diagnosis and Repair System (FDRS). There will be no charge for this service.
5 1	In the remedied instrument cluster, the warning message will be displayed for 30 minutes and the chime active for 10 seconds.
•	Revised software was implemented at the assembly plant on October 13, 2019 (Expedition) and October 10, 2019 (Mustang).

Recall Schedule :

Description of Recall Schedule :	Notification to dealers is expected to occur on May 11, 2020. Mailing of owner notification letters is expected to begin May 25, 2020 and is
	expected to be completed by May 29, 2020.
Planned Dealer Notification Date :	MAY 11, 2020 - MAY 11, 2020
Planned Owner Notification Date :	MAY 25, 2020 - MAY 29, 2020

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573